

Call for Inspection

As part of TEUFELBERGER's commitment to quality and safety, TEUFELBERGER is requesting that you immediately check (i) the hardware of certain treeMOTION Essential/Pro product harnesses for corrosion damage and (ii) any rope and/or webbing used with the harness for abrasion, in addition to the inspection intervals specified in TEUFELBERGER's instructions for use.


The high-strength aluminum utilized in the hardware of personal protective equipment ensures necessary performance characteristics of such hardware, but despite protective anodizing measures, oxidation and corrosion can occur. Various factors such as a salty atmosphere, excessive humidity, exposure to sea water or sweat, and contact with other metals can contribute to corrosion formation. Corrosion may increase the risk of abrasion of ropes and/or webbings that contact such hardware.

Proper maintenance, including frequent rinsing with clean drinking water and avoiding direct contact with other metals such as steel, is important and can reduce the likelihood of corrosion and rope and/or webbing abrasion.

With respect to a small number of treeMOTION Essential/Pro products with the following article numbers **7350316, 735016A, 7350317, 7350318, 7350319, 7350320, 7350321**, TEUFELBERGER has received reports of corrosion of aluminum hardware at increased levels. Harnesses with a production dates between 05/2022 and 10/2024 are affected. Almost all of those cases have been reported from coastal regions, humid and hot climate zones.

The article number and production date of your harness can be found on the product label.

Packaging label (outside of the bag):

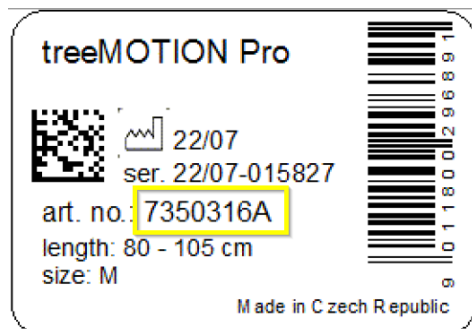





Product label (between padding and main hip/back part of the harness):

ARBORIST'S SADDLE **SIZE: M**
modell: treeMOTION Pro **MAX. LOAD: 150 kg**
 80 - 105 cm WAIST

maximum allowable free-fall: 600mm
material: PA/PES/DYNEEMA®/ALU
ser. no.: 24/10-030460
year / month of manufacture: 24/10
must be discarded at the latest by: 34/10
Manufacturer's instructions must be followed!
Only competent users should use this equipment!
Warning - Not to be used for fall arrest!
Avertissement - Ne pas utiliser comme
protection contre les chutes !
Does not comply with any standards other
than those stated on the product label!

CERTIFICATES SEE OVERLEAF



If you detect corrosion, an example of which is reflected in the image below, immediately cease use of the harness and any rope and/or webbing used in the harness and fill out the contact form “CALL FOR INSPECTION – treeMOTION”. For any other questions contact us directly at the following email address, and we will be happy to assist you:

[CALL FOR INSPECTION - treeMOTION](https://treemotion-callforinspection.paperform.co/)
(<https://treemotion-callforinspection.paperform.co/>)
safetyfirst@teufelberger.com

